SSD6202 Citrix Hypervisor 8.2 Installation Guide (Only for Supermicro motherboards)

Version 1.00

Copyright © 2021 HighPoint Technologies, Inc.

All rights reserved.

Table of Contents

| 1 Overview | 1 |
|--|----|
| 2 Installing Citrix Hypervisor to the SSD6202 controller | 1 |
| Step 1 Prepare Your Hardware for Installation | 1 |
| Step 2 Create an Array | 1 |
| Method 1: Create a RAID array via RAID Switch settings | 1 |
| Method 1: Create a RAID array via RAID Switch settings | 1 |
| Method 2: Create a RAID array using the Motherboard BIOS | 2 |
| Method 3: Create RAID in UEFI | 5 |
| Method 4: Create the RAID array using a Windows operating System, and the management software: | |
| Method 5: Create a RAID array in Hypervisor 8.2 using the CLI Tool | 7 |
| Step 3 Adjust the Motherboard BIOS Settings | 9 |
| Step 4 Install Citrix Hypervisor 8.2 to the SSD6202 | 10 |
| Appendix | 13 |
| Troubleshooting | 13 |
| The CLI reports that "No NVMe Controller is found" | 13 |
| 2. Check the RAID create via RAID Switch settings is created or not | 13 |

1 Overview

This guide explains how to install Hypervisor to an NVMe SSD or array hosted by the SSD6202 controller.

For Citrix Hypervisor 8.2

Mirror link: https://www.citrix.com/downloads/search.html?qs=Citrix+Hypervisor+8.2

2 Installing Citrix Hypervisor to the SSD6202 controller

Step 1 Prepare Your Hardware for Installation

After installing the NVMe SSDs into the SSD6202 controller, you can configure the SSD's as a RAID array, or use them as separate, single disks.

Before installation, you must temporarily remove all the NVMe SSD, which are not physically attached to SSD6202 controller, from your system. These can be reinstalled after Hypervisor is up and running.

Note: Citrix Hypervisor 8.2 only supports UEFI Boot when used with the SSD6202. If you have other SCSI-class adapters installed, you must make sure the SSD6202 controller UEFI support is loaded first; otherwise the system may be unable to boot. If the SSD6202 is not loading first, try moving it to another PCIe slot.

Step 2 Create an Array

If you would like to configure a RAID array using NVMe SSD's hosted by the SSD6202, please select 1 of the following 5 Methods.


Method 1: Create a RAID array via RAID Switch settings

Method 1: Create a RAID array via RAID Switch settings

1. Connect two NVMe SSD's to the SSD6202.

Note: make sure that there is no RAID or residual partitions in the two NVMe SSD's.

2. Create RAID arrays via RAID Switch settings.

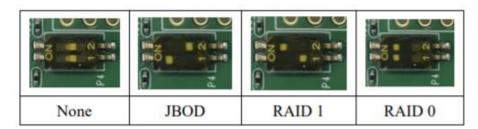

Note: If you don't want to use RAID Switch to create RAID, please make sure the switch setting is None.


Method 2: Create a RAID array using the Motherboard BIOS

Using the SuperMicro H11DSi motherboard as an example:


1. Set 'Boot mode select' to 'UEFI'.



2. Next, under "Advanced->PCIe/PCI/PnP Configuration, change "CPU Slot x PCI-E OPROM" to "EFI". "x" refers to the slot number (slot 2 was used when the screenshot was taken). Please consult the motherboard manual for more information.

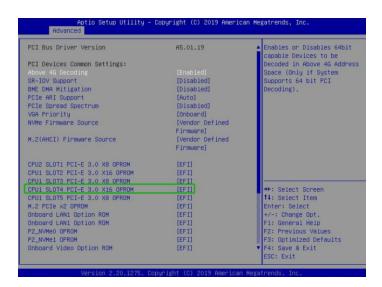


- 3. Creating the RAID array:
 - a. Select "Advanced→Marvell NVMe Configuration Utility";

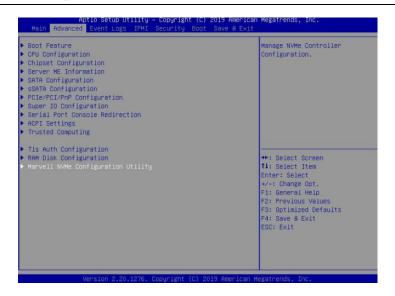

Note: If you cannot find "Marvell NVMe Configuration Utility" in the motherboard BIOS under "advanced" interface, you will need to create the array using one of the other four methods.


b. Next, select "Create RAID Configuration". Press "Enter" to open the Configuration Utility.

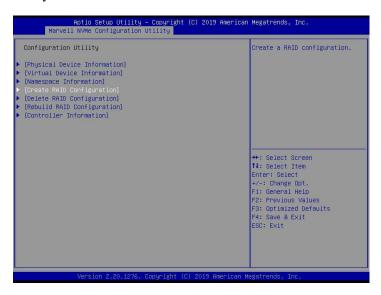


c. Set "RAID Configuration Menu" to "Enabled", and then select "Goto RAID Config".



d. For "Would you like to create this virtual disk?" select "Yes", then select "Goto Namespace Configuration".

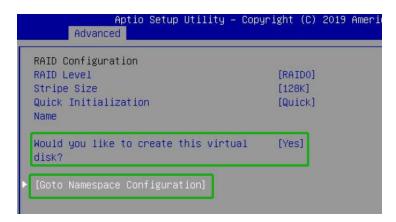

e. For "Would you like to create those namespace on the virtual disk?" select "Yes", then select "Accept" to create the RAID0 array.

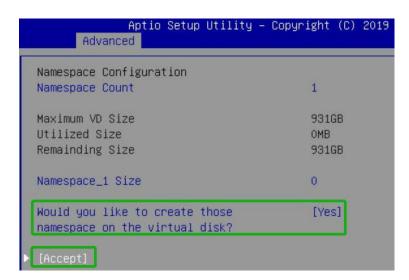

f. When the page displays "Successful!" select OK, to exit the menu;



Method 3: Create RAID in UEFI


1. First, prepare the UEFI Tool. This file should be copied to the root of a bootable USB flash drive.

Using the SuperMicro H11DSi motherboard as an example:

2. Set 'Boot mode select' to 'UEFI';



3. Choose to boot from the USB flash drive (shown as "UEFI: SanDisk, Partition 1" for the example below):

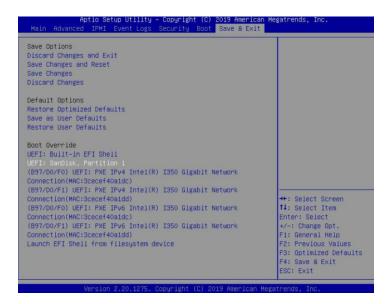

4. After entering the UEFI Shell, select "FS0:" to access the USB flash drive:.

Note: "FS0" is the name of the USB flash drive used for this example

```
UEFI Interactive Shell v2.2

EDK II

UEFI v2.70 (American Megatrends, 0x0005000E)

Mapping table

FSO: Alias(s):HD0q0b:;BLK1:

PciRoot(0x0)/Pci(0x14,0x0)/USB(0x10,0x0)/HD(1,MBR,0x48D2E0C7,0x3F,0x72)

9BFC1)

BLK0: Alias(s):

PciRoot(0x0)/Pci(0x14,0x0)/USB(0x10,0x0)

Proces ESO: in 4 seconds to skip startup.nsh or any other key to continue.

Shell> FSO:
```

5. Next, locate the "mnv_cli.efi" program and run it:

```
FSO:\> cd uefi\64
FSO:\uefi\64\> mnv_cli.efi
CLI version. 1.0.0.1041
Welcome to NVMe Command Line Interface.
```

Note: if the CLI reports that "No NVMe Controller is found", please see Appendix – Troubleshooting.

6. To create a RAID0 array using two NVMe SSD's, enter the following command:


create -r 0 -d 0,1

```
> create -r 0 -d 0,1
Create virtual disk successfully.
> _
```

For more CLI commands, please download the CLI manual from the product page of the official website.

Method 4: Create the RAID array using a Windows operating System, and the WebGUI management software:

- This method assumes you have access to a Windows Server 2019 system and have installed the WebGUI software.
- 2. Open the WebGUI, select the Logical tab. Click "Create Array", and configure the array as desired using the drop-down menus and selection boxes. Once configured, click the "Create" button to create the array (the exampe below shows 2 NVMe SSD's configured as a RAID 0 array).

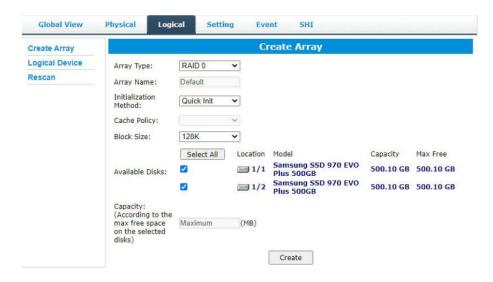

3. Once the array has been created, it will be displayed under **Logical Device Information**.



Method 5: Create a RAID array in Hypervisor 8.2 using the CLI Tool

- a. This method assumes that you have already prepared a Hypervisor system.
- b. Open the Citrix Hypervisor 8.2 Shell (Ctrl+Alt+F6).

```
Citrix Hypervisor Host 8.2.0

System Booted: 2021-03-03 06:04

Your Citrix Hypervisor Host has now finished booting.
To manage this server please use the Citrix XenCenter application.
You can install XenCenter for Windows from https://www.citrix.com/downloads/citrix-hypervisor.
You can connect to this system using one of the following network
addresses:

IP address not configured

localhost login: root
Password:
Last login: Wed Mar 3 05:59:08 on ttu4

Citrix Hypervisor dom0 configuration is tuned for maximum performance and reliability.
```

- c. Boot the system, and enter the username and password to start Hypervisor.
- d. Copy the CLI package into the root directory of a USB flash drive. Use the following command to copy the mnv_cli package to home directory:

cp mnv cli/home

```
[root@localhost 64]# ls
mnv_cli
[root@localhost 64]# cp mnv_cli /home/
```

e. Access the home directory and enter the following command to start the CLI:

./mnv_cli

```
[root@localhost 64]# cd /home/
[root@localhost home]# ./mnv_cli
CLI Version: 1.0.0.1041
Welcome to NVMe Command Line Interface.
```

f. To create a RAID0 array using two NVMe SSD's, enter the following command.

create -r 0 -d 0,1

```
> create -r 0 -d 0,1
Create virtual disk successfully.
> _
```

For more CLI commands, please download the CLI manual from the product page of the official website.


Step 3 Adjust the Motherboard BIOS Settings

Using the Super Micro H11DSi motherboard as an example:

1. In the system BIOS SETUP menu, change 'Boot mode select' to 'UEFI;



2. Under "Advanced→PCIe/PCI/PnP Configuration, change the setting for "CPU Slot x PCI-E OPROM" to "EFI". "x" refers to the slot number (slot 4 was used when the screenshot was taken). Please consult the motherboard manual for more information.

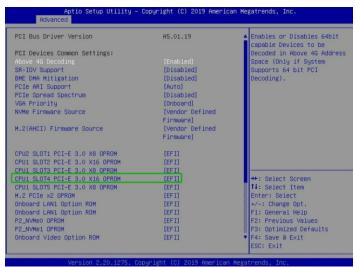

3. Set "Secure Boot " to "Disabled".



Step 4 Install Citrix Hypervisor 8.2 to the SSD6202

- 1. Boot from the Citrix Hypervisor Installation DVD (UEFI mode).
- 2. When the Installation screen appears, please select "Install" to install Citrix Hypervisor 8.2.




3. When the installation switches to the graphical interface, select "OK".




4. When prompted, select "**OK**" to continue.




5. Select "Accept EULA".

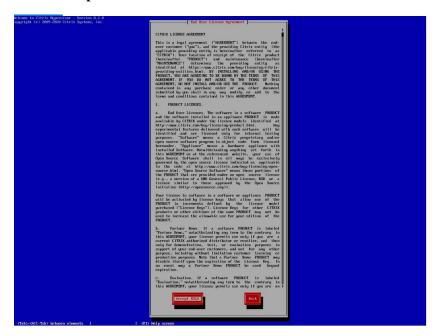

6. After confirming the EULA agreement, you will be asked to select the target disk. Select the RAID array as the target disk to install the Citrix Hypervisor 8.2. You can then proceed normally - follow the onscreen prompts to install Hypervisor to the array.

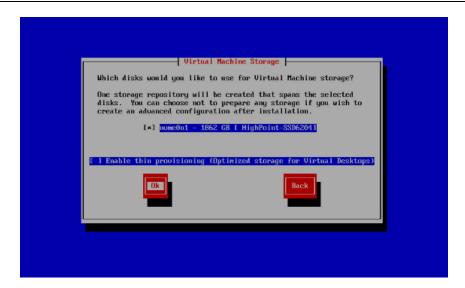

7. After the installation is complete, select appropriate startup item (HighPoint – SSD6202 as shown in the following example), to boot Hypervisor.

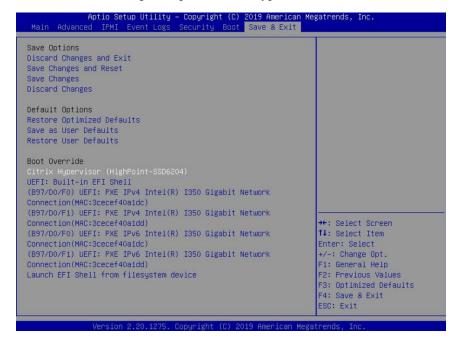

8. Enter the user name and password to log into Citrix Hypervisor 8.2.

Appendix


Troubleshooting

- 1. The CLI reports that "No NVMe Controller is found"
 - After starting "mnv-cli.efi", the utility reports "No NVME Controller is found" (as shown below):

```
anagement CLI\1.0.0.1041_sign\uefi\64\> mnv_cli.efi
No NVMe Controller is found.
CLI Version: 1.0.0.1041
Welcome to NVMe Command Line Interface.
```

2) You will need check and make sure the system recognizes the SSD6202. First, enter the following command using the UEFI tool:

pci -b



3) If the interface reports "Vendor 1B4B Device 2241 Prog Interface 2", the SSD6202 is recognized by the motherboard, but cannot support the UEFI tool. In this case, you will need to create the array using one of the other methods described in this manual (BIOS, CLI or WebGUI).


```
00 D8 00 00 ==> Mass Storage Controller – Non-volatile memory subsyst
em

Vendor 1B4B Device 2241 Prog Interface 2
FS0:\> FS0:_
```


- 4) If the interface does not display "Vendor 1B4B Device 2241 Prog Interface 2", then the motherboard does not recognize the SSD6202.
 - a. Power down the system, and make sure the SSD6202 is securely installed into the PCIe slot
 - b. Boot the system and enter the motherboard BIOS utility. Make sure the required BIOS settings are still enabled (refer to page 1)
- 2. Check the RAID create via RAID Switch settings is created or not

Method 1: Check in BIOS Utility

- 1) Set the Slot Storage OPROM of SSD6202 in the motherboard BIOS to **UEFI.**
- 2) Set 'Boot mode select' to 'UEFI'.
- 3) From the motherboard BIOS menu, select "Marvell NVME Configuration Utility":

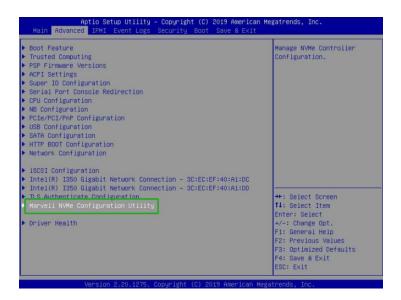


4) Select the "Virtual device information"

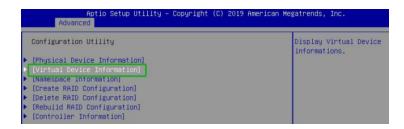

5) Select the "[0] New_VD":




6) As shown in the figure below, you can see the RAID0 information.

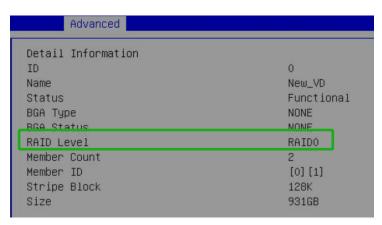

Method 2: check in UEFI

1. Choose to boot from the USB flash drive (shown as "UEFI: SanDisk, Partition 1" for the example below):

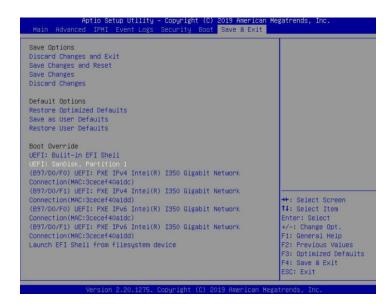


2. Next, locate the "mnv_cli.efi" program and run it:



3. you can recognized the RAIDO by entering the following command:

info -o vd

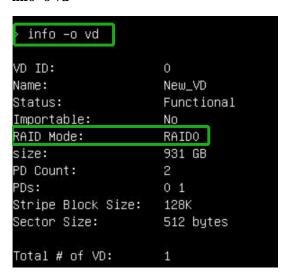

Method 3: check in a windows operating System

- This method assumes you have access to a Windows Server 2019 system and have installed the WebGUI software.
- 2. Open the WebGUI software, it will be displayed under **Logical Device Information**.



Method 4: check in a CLI

- 1. This method assumes that you have already prepared a Citrix Hypervisor system.
- 2. Refer to "Step 2 Create an array→Method 5" to install CLI tool in the system.
- 3. Run CLI by the following command:

./mnv_cli

```
[root@localhost home]# ./mnv_cli
CLI Version: 1.0.0.1041
Welcome to NVMe Command Line Interface.
```

4. you can recognized the RAIDO by entering the following command:

info -o vd

