SSD6204 Hyper-V Server 2019 Installation Guide

Version 1.00

Copyright © 2021 HighPoint Technologies, Inc.

All rights reserved.

Table of Contents

1.	Overview	1
 2. I	nstalling Hyper-V Server 2019 to the SSD6204 controller	
	Step 1 Prepare Your Hardware for Installation	
	Step 2 Create an Array	1
	Method 1: Create a RAID array using the Motherboard BIOS	1
	Method 2: Create RAID in UEFI	5
	Method 3: Create the RAID array using a Windows operating System, and the WebC management software:	
	Method 4: Create a RAID array using Hyper-V Server 2019 via the CLI	8
	Step 3 Adjust the Motherboard BIOS Settings	9
	Step 4 Install Hyper-V Server 2019 to the SSD6204	10
Ap	pendix	13
	Troubleshooting	
	1. The CLI reports that "No NVMe Controller is found"	13
	The replacement SSD6204 controller cannot recognize the RAID array	13

1. Overview

This guide explains how to install Hyper-V Server 2019 to an NVMe SSD or array hosted by the SSD6204 controller.

Hyper-V Server 2019

Mirror link:

https://www.microsoft.com/en-us/evalcenter/evaluate-hyper-v-server-2019

2. Installing Hyper-V Server 2019 to the SSD6204 controller

Step 1 Prepare Your Hardware for Installation

After installing the NVMe SSDs into the SSD6204 controller, you can configure the SSD's as a RAID array, or use them as separate, single disks.

Before installation, you must temporarily remove all the NVMe SSD, which are not physically attached to SSD6204 controller, from your system. These can be reinstalled after Hyper-V Server 2019 is up and running.

Note: Hyper-V Server 2019 requires UEFI Boot support when used with the SSD6204. If you have other SCSI-class adapters installed, you must make sure the SSD6204 controller UEFI support is loaded first; otherwise the system may be unable to boot. If the SSD6204 is not loading first, try moving it to another PCIe slot.


Step 2 Create an Array

If you would like to configure a RAID array using NVMe SSD's hosted by the SSD6204, please select 1 of the following 4 Methods.


Method 1: Create a RAID array using the Motherboard BIOS

Using the SuperMicro X11DPi-NT motherboard as an example:


1. Set 'Boot mode select' to 'UEFI'.

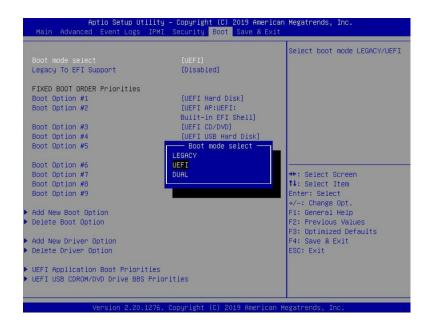

2. Next, under "Advanced->PCIe/PCI/PnP Configuration, change "CPU Slot x PCI-E OPROM" to "EFI". "x" refers to the slot number (slot 2 was used when the screenshot was taken). Please consult the motherboard manual for more information.

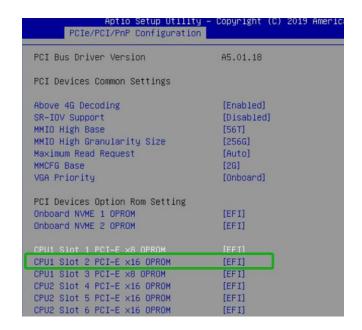

- 3. Creating the RAID array:
 - a. Select "Advanced→Marvell NVMe Configuration Utility";

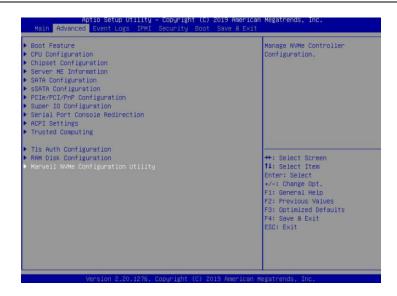

Note: If you cannot find "Marvell NVMe Configuration Utility" in the motherboard BIOS under "advanced" interface, you will need to create the array using one of the other three methods.

b. Next, select "Create RAID Configuration". Press"Enter"to open the Configuration Utility.



c. Set "RAID Configuration Menu" to "Enabled", and then select "Goto RAID Config".



d. For "Would you like to create this virtual disk" select "Yes", then select "Accept" to create the RAID0 array.



e. When the page displays "Successful!" select OK, to exit the menu;



Method 2: Create RAID in UEFI


1. First, prepare the UEFI Tool. This file should be copied to the root of a bootable USB flash drive.

Using the SuperMicro X11DPi-NT motherboard as an example:

2. Set 'Boot mode select' to 'UEFI';



3. Choose to boot from the USB flash drive (shown as "UEFI: SanDisk, Partition 1" for the example below):

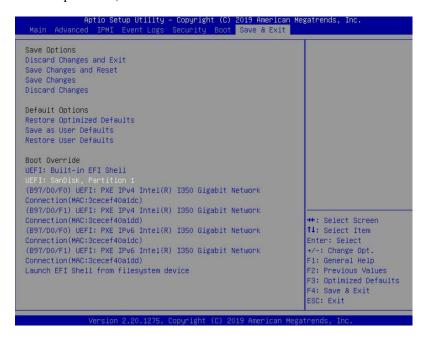

4. After entering the UEFI Shell, select "**FS0**:" to access the USB flash drive:.

Note: "FS0" is the name of the USB flash drive used for this example

```
UEFI Interactive Shell v2.2
EDK II
UEFI v2.70 (American Megatrends, 0x0005000E)
Mapping table
FSO: Alias(s):HD0q0b:;BLK1:
PciRoot(0x0)/Pci(0x14,0x0)/USB(0x10,0x0)/HD(1,MBR,0x48D2E0C7,0x3F,0x72
9BFC1)
BLK0: Alias(s):
PciRoot(0x0)/Pci(0x14,0x0)/USB(0x10,0x0)
Proce E90 in 4 seconds to skip startup.nsh or any other key to continue.
Shell> FSO:
```

5. Next, locate the "mnv_cli.efi" program and run it:

```
FSO:\> cd uefi\64
FSO:\uefi\64\> mnv_cli.efi
CLI version. 1.0.0.1041
Welcome to NVMe Command Line Interface.
```

Note: if the CLI reports that "No NVMe Controller is found", please see Appendix – Troubleshooting.


6. To create a RAID0 array using two NVMe SSD's, enter the following command: create -r 0 -d 0,1

```
> create -r 0 -d 0,1
Create virtual disk successfully.
> _
```

For more CLI commands, please download the CLI manual from the product page of the official website.

Method 3: Create the RAID array using a Windows operating System, and the WebGUI management software:

- This method assumes you have access to a Hyper-V Server 2019 system and have installed the WebGUI software.
- 2. Open the WebGUI, select the Logical tab. Click "Create Array", and configure the array as desired using the drop-down menus and selection boxes. Once configured, click the "Create" button to create the array (the exampe below shows 4 NVMe SSD's configured as a RAID 0 array).

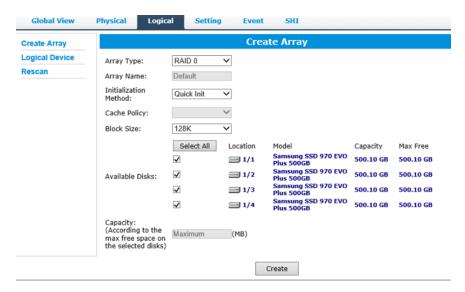

3. Once the array has been created, it will be displayed under **Logical Device Information**.



Method 4: Create a RAID array using Hyper-V Server 2019 via the CLI

- a. This method assumes that you have already prepared a Hyper-V Server 2019 system.
- b. Boot the system, and enter the password to start Hyper-V Server 2019.
- c. Copy the CLI package into the root directory of a USB flash drive.
- d. Entering the USB flash drive, Use the following command to check whether the CLI file in the USB flash drive.

dir

```
Volume in drive E is USB
Volume Serial Number is 16E9-4434
Directory of E:\
            10:46 AM
1/13/2020
                         <DIR>
                                          System Volume Information
            09:48 AM
                         <DIR>
                                          Tool
                                          nevo_package_20200619
  10/2021
                                    8,071 Capture.PNG
                                    3,010 Captureas.PNG
                         <DIR>
  12/2021
                                          gxx
                          <DIR>
                                          update
                                 395,344 mnv_cli.exe
                                  406,425 bytes
               5 Dir(s)
                          58,719,961,088 bytes free
```

e. enter the following command to start the CLI:

./mnv_cli.exe

```
::\>mnv_cli.exe
CLI Version: 1.0.0.1041
Welcome to NVMe Command Line Interface.
```

f. To create a RAID0 array using four NVMe SSD's, enter the following command


```
CLI Version: 1.0.0.1041
Welcome to NVMe Command Line Interface.
> create -r 0 -d 0,1,2,3
Create virtual disk successfully. Please shutdown and power on the system.
>
```

Note: For more CLI commands, please download the CLI manual from the product page of the official website.


Step 3 Adjust the Motherboard BIOS Settings

Using the Super Micro X11DPi-NT motherboard as an example:

1. In the system BIOS SETUP menu, change 'Boot mode select' to 'UEFI;

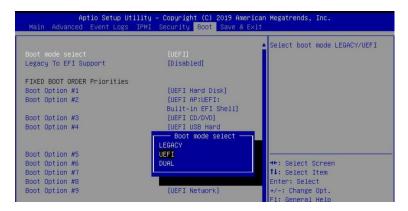

 Under "Advanced→PCIe/PCI/PnP Configuration, change the setting for "CPU Slot x PCI-E OPROM" to "EFI". "x" refers to the slot number (slot 2 was used when the screenshot was taken). Please consult the motherboard manual for more information.

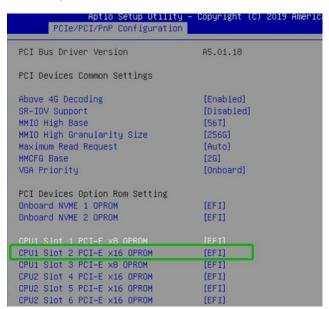


3. Set "Secure Boot " to "Disabled".




Step 4 Install Hyper-V Server 2019 to the SSD6204


- a. Boot from the installation DVD (UEFI mode).
- b. When the Installation screen appears, make your selections from the drop-down menus and press "**Next**" to start installation:

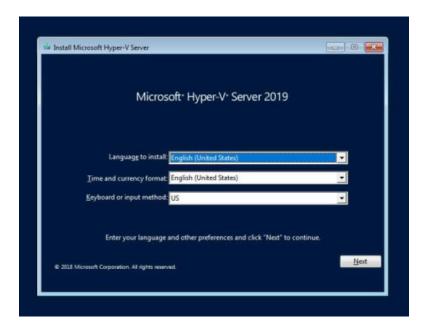


c. Click "Install now" to proceed:

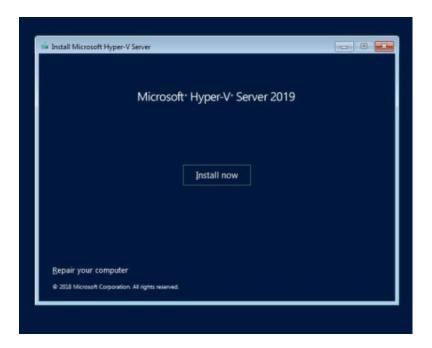


d. Check "I accept the license terms", then click "Next" to continue:

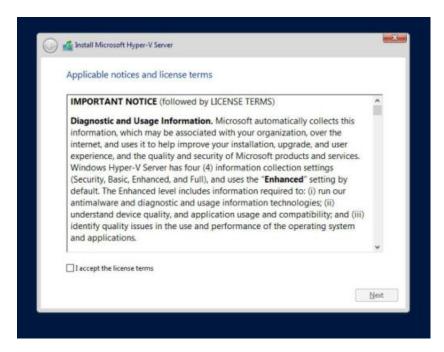

e. During installation, you will be asked to select the target disk. Select the RAID array you created previously as the target disk to install the Hyper-V Server 2019. You can then proceed normally follow the onscreen prompts to install Hyper-V Server 2019 to the array.

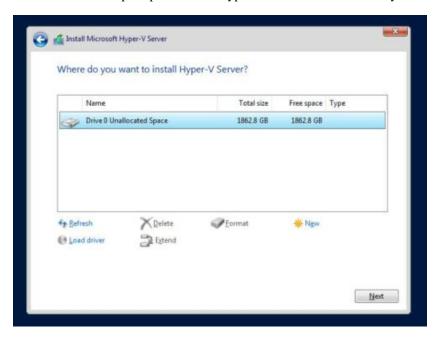

f. After installation is complete, select the appropriate startup item to boot the system:

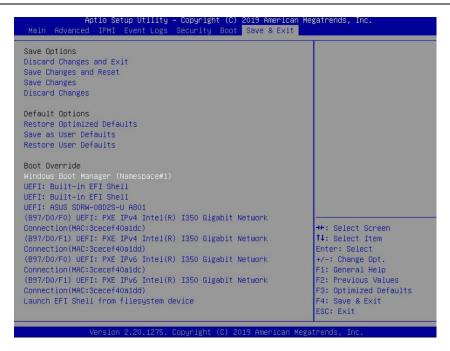

g. Enter the username and password to log into Hyper-V Server 2019.

Appendix

Troubleshooting

- 1. The CLI reports that "No NVMe Controller is found"
- After starting "mnv-cli.efi", the utility reports "No NVME Controller is found" (as shown below):

```
anagement CLI\1.0.0.1041_sign\uefi\64\> mnv_cli.efi
No NVMe Controller is found.
CLI Version: 1.0.0.1041
Welcome to NVMe Command Line Interface.
```

2) You will need check and make sure the system recognizes the SSD6204. First, enter the following command using the UEFI tool:

pci-b

```
FS0:\> pci -b_
```

3) If the interface reports "Vendor 1B4B Device 2241 Prog Interface 2", the SSD6204 is recognized by the motherboard, but cannot support the UEFI tool. In this case, you will need to create the array using one of the other methods described in this manual (BIOS, CLI or WebGUI).

```
00 D8 00 00 ==> Mass Storage Controller – Non–volatile memory subsyst
em

Vendor 1848 Device 2241 Prog Interface 2

FSO:\> FSO:_
```

- 4) If the interface does not display "Vendor 1B4B Device 2241 Prog Interface 2", then the motherboard does not recognize the SSD6204.
 - a. Power down the system, and make sure the SSD6204 is securely installed into the PCIe slot
 - b. Boot the system and enter the motherboard BIOS utility. Make sure the required BIOS settings are still enabled (refer to page 1)
- 2. The replacement SSD6204 controller cannot recognize the RAID array

Existing RAID arrays may not be recognized if you simply transfer the NVMe SSD's from one controller to another.

Diagram before replacing NVMe to the new SSD6204:

```
Boot Override
Windows Boot Manager (Namespace#1)
USB#0:SanDisk
IBA 40G Slot 6000 v1066
UEFI: SanDisk, Partition 1
UEFI: Built-in EFI Shell
Launch EFI Shell from filesystem device
```

Diagram after replacing NVMe to the new SSD6204:

```
Boot Override
UEFI: Built-in EFI Shell
UEFI: SanDisk, Partition 1
```


This problem can be resolved by importing the array using the new host controller. There are 3 ways to import an existing RAID configuration. This command is a Simple API feature to import a VD when an importable VD roams from one controller to another. If NVMe Controller supports the RAID mode, this function will import VD.

If VD is created from one controller and the SSD with VD roamed to another controller, the VD needs to be imported first before the firmware reports the VD to the OS.


Note: The user can use > info -o VD command to check if the VD status to be imported or not.

Method 1: Import the RAID array using the BIOS Utility


- 1) Set the Slot Storage OPROM of SSD6204 in the motherboard BIOS to UEFI.
- 2) Set 'Boot mode select' to 'UEFI'.
- 3) From the motherboard BIOS menu, select "Marvell NVME Configuration Utility":

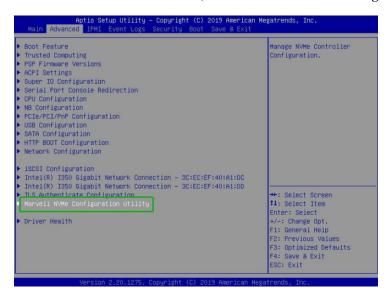

4) Next, select "Virtual Device Information":

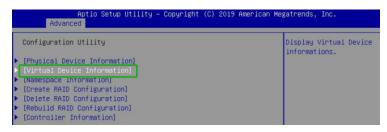

5) Click "Import".

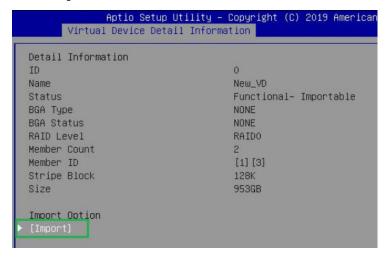

6) After restarting the system, you can recognized the RAID0 and can see that the status of the RAID has changed by entering "Virtual device information→[0] New_VD"



Method 2: Import the RAID array using the UEFI Utility


- 1) Copy mnv_cli to the root directory of a bootable USB flash drive.
- 2) Boot to the flash drive and enter the following command:

import -I 0

```
FSO:\> mnv_cli.efi
CLI Version: 1.0.0.1041
Welcome to NVMe Command Line Interface.
> info -o vd
VD ID:
Name:
                        New_VD
Status:
                        Functional
Importable:
RAID Mode:
                        RAIDO
                        953 GB
size:
PD Count:
                        1 3
PDs:
Stripe Block Size:
                        128K
Sector Size:
                        512 bytes
Total # of VD:
> import -1 0
VD 0 import successfully.
```

3) After restarting the system, you can recognized the RAIDO and can see that the status of

the RAID has changed by entering the command: $\mbox{info-o}\ \mbox{vd}$

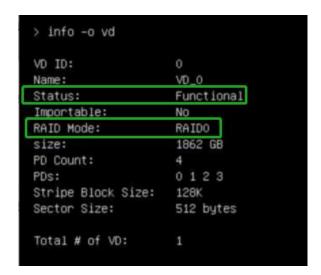

Method 3: Import the RAID array using the CLI tool:

1) Run mnv_cli.exe using the following command:

./mnv_cli

```
[root@DESKTOP-7FT8SGF:/opt/marvell/nvme] ./mnv_cli
CLI Version: 1.0.0.1039
Welcome to NVMe Command Line Interface.
```

2) Entering the command: import –I 0

```
CLI Version: 1.0.0.1041
Welcome to NVMe Command Line Interface.

> import -1 0

VD 0 import successfully. Please shutdown and power on the system.
>
```

3) After restarting the system, you can recognized the RAIDO and can see that the status of

the RAID has changed by entering the command: \mbox{info} -o \mbox{vd}

